


DRAWING NO.  
10044342

BURNDY MOLD CAT. NO.	BURNDY ITEM NUMBER	CABLE		WELD METAL	HANDLE CLAMPS
		RUN	TAP		
B-5432*	10047907	#6	#6	45	B40-4565-00
B-2687	10047908	#4	#4	65	B-106
B-2689	10047909	#2	#2	90	B-106
B-2690	10047910	#2	#4	65	B-106
B-2691	10047911	#1	#1	115	B-106
B-2692	10047912	#1	#2	90	B-106
B-2693	10047913	#1	#4	90	B-106
B-2694	10047914	1/0	1/0	150	B-106
B-2695	10047915	1/0	#1	150	B-106
B-2696	10047916	1/0	#2	115	B-106
B-2697	10047917	1/0	#4	115	B-106
B-2698	10047921	2/0	2/0	200	B-106
B-2699	10047922	2/0	1/0	200	B-106
B-2700	10047923	2/0	#1	150	B-106
B-2701	10047924	2/0	#2	150	B-106
B-2702	10047925	3/0	3/0	250	B-106
B-2703	10047926	3/0	2/0	200	B-106
B-2704	10047927	3/0	1/0	200	B-107
B-2705	10047928	3/0	#1	150	B-107
B-2706	10047929	3/0	#2	150	B-107
B-2707	10047930	4/0	4/0	250	B-107
B-2708	10047931	4/0	3/0	250	B-107
B-2709	10047932	4/0	2/0	200	B-107
B-2710	10047933	4/0	1/0	200	B-106
B-2711	10047934	4/0	#1	150	B-106
B-2712	10047935	4/0	#2	150	B-106
B-2713	10047936	250 kcmil	250 kcmil	2-150	B-106
B-2714	10047937	250 kcmil	4/0	2-150	B-106
B-2715	10047938	250 kcmil	3/0	2-150	B-106
B-2716	10047939	250 kcmil	2/0	250	B-106
B-2717	10047940	250 kcmil	1/0	150	B-106
B-2718	10047941	250 kcmil	#1	200	B-106
B-2719	10047942	250 kcmil	#2	150	B-106
B-2747	10047943	500 kcmil	500 kcmil	3-250	B-107
B-2751	10047944	500 kcmil	250 kcmil	500	B-107
B-2752	10047945	500 kcmil	4/0	500	B-107
B-2753	10047946	500 kcmil	3/0	500	B-107
B-2754	10047947	500 kcmil	2/0	2-200	B-107
B-2755	10047948	500 kcmil	1/0	2-150	B-106
B-2756	10047949	500 kcmil	#1	250	B-106
B-2757	10047950	500 kcmil	#2	250	B-106

REV.	DATE	DESCRIPTION	ECO	BY	C'K'D.
A	12/8/04	DRAWING RELEASED	10262	PL	DS

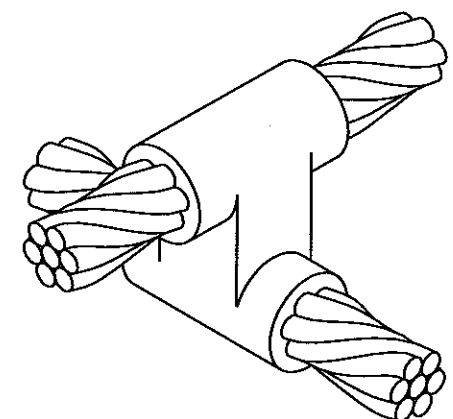

**NOTES:**

- BCC-11 TYPE MOLDS ARE USED TO JOIN UN-CUT HORIZONTAL CABLES AT RIGHT ANGLES TO EACH OTHER.
- SIZE RANGE IS #6 THROUGH 500 kcmil SOLID OR CONCENTRIC STRANDED COPPER CONDUCTORS.
- MOLDS LISTED ARE FOR CONCENTRIC STRANDED CABLE. ADD SUFFIX "-S" TO MOLD NUMBER FOR SOLID CONNECTORS.
- FOR HEAVY DUTY MOLDS, MOLDS WITH WEAR PLATES OR MOLDS FOR COPPERWELD® CABLE, CONTACT BURNDY® PRODUCTS.
- REQUIRED TOOLS: HANDLE CLAMPS (SEE TABLE ABOVE), FOR HANDLES SEE DRAWING 10051615.  
\*SOLD COMPLETE WITH HANDLES  
B38-0309-00 FLINT IGNITOR (DRAWING 10051616).
- OTHER RECOMMENDED ACCESSORIES: DRAWING 10051616  
B40-0319-01: MOLD CLEANER FOR CARTRIDGE SIZES #15 - #65  
B40-0319-03: MOLD CLEANER FOR CARTRIDGE SIZES #90 - #500  
B38-3922-00: MOLD CLEANING BRUSH  
B38-0135-00: CABLE CLEANING BRUSH  
B38-0330-00: CABLE CLAMP

TO ORDER BURNDY® PRODUCTS CALL 1-800-346-4175  
MANCHESTER, NH 03109, USA  
FOR PRODUCT INFO = <http://www.burndy.com>

BURNDYWeld™ HORIZONTAL TO HORIZONTAL CABLE CROSS

ITEM NO: N/A

CAT NO: BCC-11 SERIES

SCALE: N/A

DRAWN BY: P LAPONIUS 12/8/04

CHECKER: D SHEBUIA 1/3/05

DSN APPVL: D SHEBUIA 1/13/05

MFG APPVL: ---

QC APPVL: J BRODEUR 1/14/05

MKT APPVL: R ROUCHEAU 1/18/05

PROJ FAM: ---

PROJECT #: ---

DOCUMENT TYPE: Sales

REL LEVEL: AutoCAD

DRAWING NO: 10044342

REV: A

SIZE: D

SHEET 1 OF 1

